# Honeywell

# 5800SS1

WIRELESS SHOCK SENSOR



Honeywell's 5800SS1 Wireless Shock Sensor has been designed to mount directly on the glass surface and offers excellent protection for all glass types—including plate, tempered, laminated and wired.

The compact, versatile detector provides outstanding false alarm immunity.

#### **FEATURES**

- Effective in acoustically hard areas such as kitchens, bathrooms, skylights and occupied areas
- Mounts directly to glass surfaces with 3M<sup>™</sup> adhesive tape
- Mounts quickly and easily without having to remove the cover
- Protects all types of glass
- No adjustments required
- Quick and easy installation-simply pull the battery tab to enroll the transmitter, peel the adhesive backing and mount

#### **SPECIFICATIONS**

#### Glass Coverage

Plate, laminated, wired, sealed insulated, coated and tempered, up to 1/4 inches, (6.35mm) thick

10 ft (3m) distance from mounting location

One sensor is required for each separate pane of glass

#### Dimensions

1.6 inches H x 1.6 inches W x 0.8 inches D  $(41mm \times 41mm \times 20mm)$ 

#### Power

Single 3V Panasonic CR2, Sanyo CR2, or Duracell DLCR2 lithium battery

### • Operating Temperature


 $0^{\circ}$ F to  $130^{\circ}$ F (-18°C to +55°C)

#### Compatibility

Use with all Vista control panels that support 5800 Series wireless devices

# 5800SS1

## WIRELESS SHOCK SENSOR

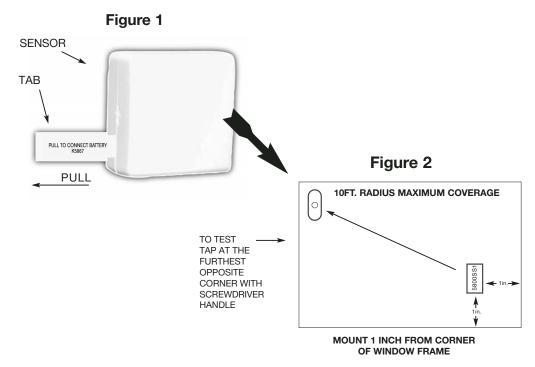

# **INSTALLATION**

- The 5800SS1 serial number must be enrolled into the control panel prior to usage in the system. To activate the transmitter, remove the "PULL TO CONNECT BATTERY" tab (see figure 1). For additional transmissions, lightly tap on the base of the sensor.
- Determine the optimum mounting location. The sensor should be mounted one inch from the comer edge of the window frame (see Figure 2).
- Mount to glass by removing the 3M<sup>™</sup> tape backing paper and firmly pressing the sensor in the desired mounting location as shown.
- To verify operation, tap the furthest opposite corner of the glass with a screwdriver handle.
- Positive verification ensures detection. The energy required to break the glass is significantly greater.

### **ORDERING**

5800SS1

Wireless Shock Sensor

**Honeywell**